


This Instruction Applies To The Following Modules :




OH097 Minor Arc Overhead Ladder
 OH100 Trapeze Arc
 OH104 Peak Overhead
 OH105 Pinnacle Overhead

Parts List

- 1** Overhead
- 4** 2T-0604 - Button Cap Torx w/ Pin 3/8" x 1"
4 5F-0500 - Flat Washer 5/16" S/S w/ 3/8" Hole

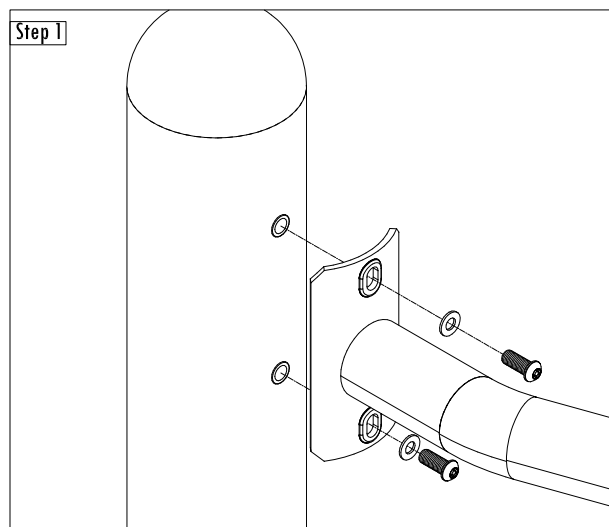


1" Button Cap, Flat Washer (x4)

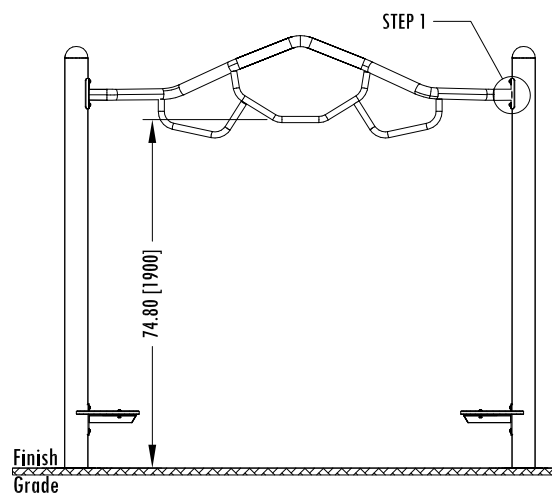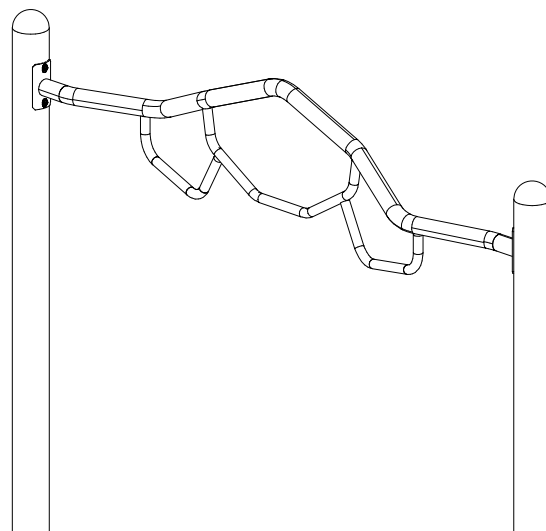


Parts List



1	CLM11200	Spider Net Support Bar
4	SHP16700	Spider Net Pucks
1	CLM11100	Spider Net
4	2T-0604	Button Cap Torx w/ Pin 3/8" x 1"
4	SF-0500	Flat Washer 5/16" S/S w/ 3/8" Hole

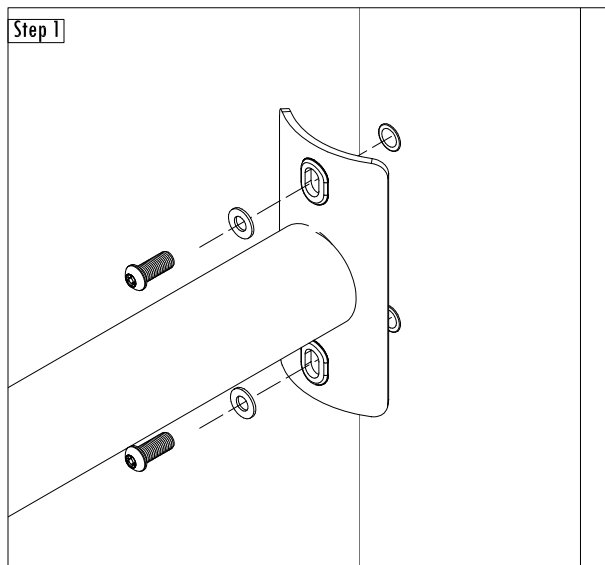

1" Button Cap, Flat Washer (x4)

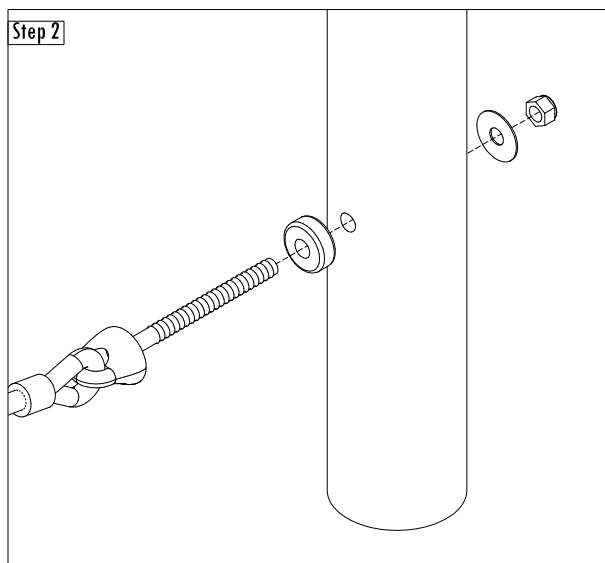


Make connection as shown, cut off protruding bolt & remove any sharp edges.

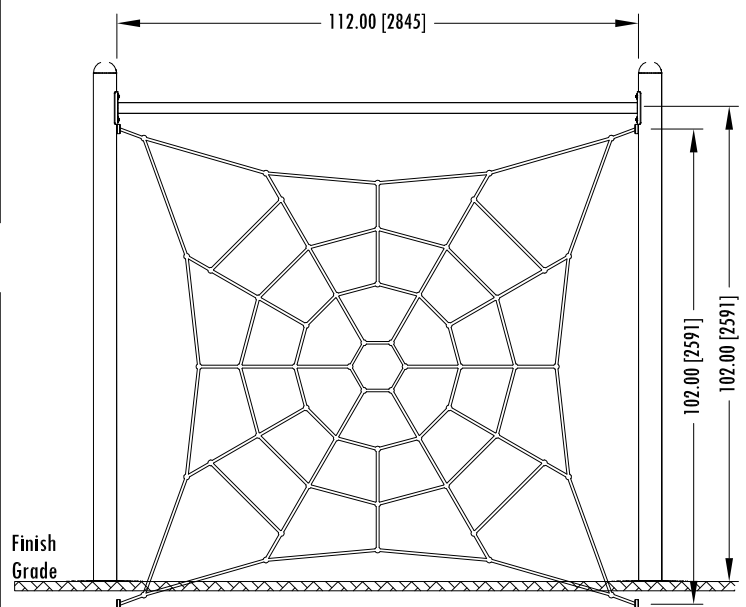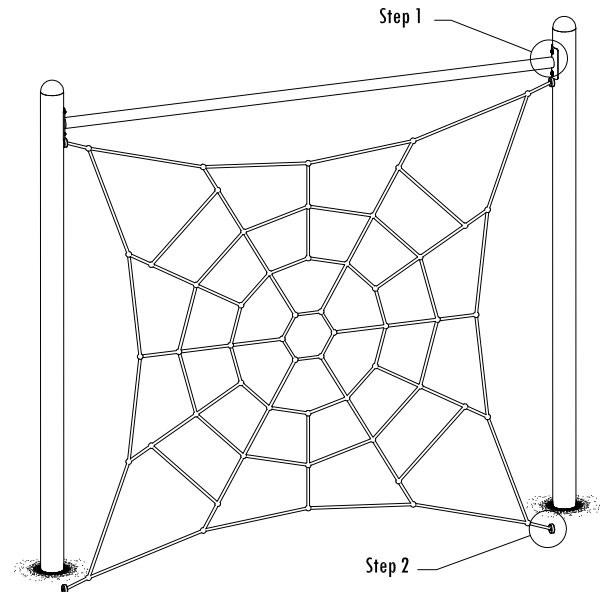


Parts List




- 1 FRM01500 Frame
- 1 SHP18300 Plastic
- 4 2T-0604 - Button Cap Torx w/ Pin 3/8" x 1"
- 4 2T-0606 - Button Cap Torx w/ Pin 3/8" x 1-1/2"
- 4 4L-0600 - Lock Nut w/ Nylon Locking 3/8"
- 12 5F-0500 - Flat Washer 5/16" S/S w/ 3/8" Hole

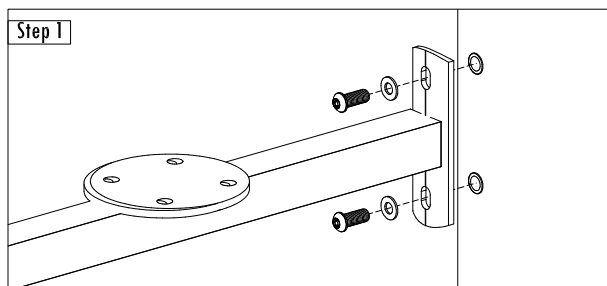

1" Button Cap, Flat Washer (x4)

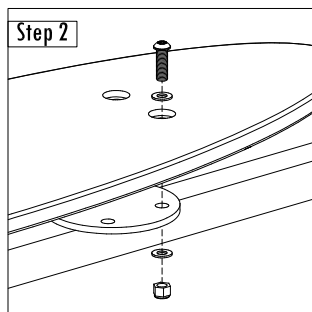


1-1/2" Button Cap, Flat Washers,
Lock Nut (x4)

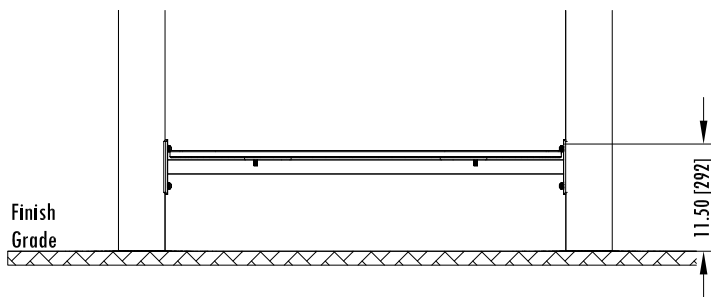
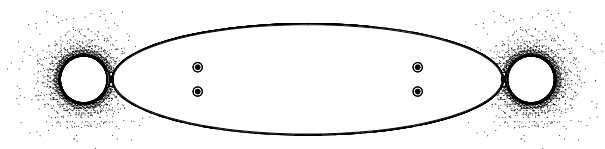
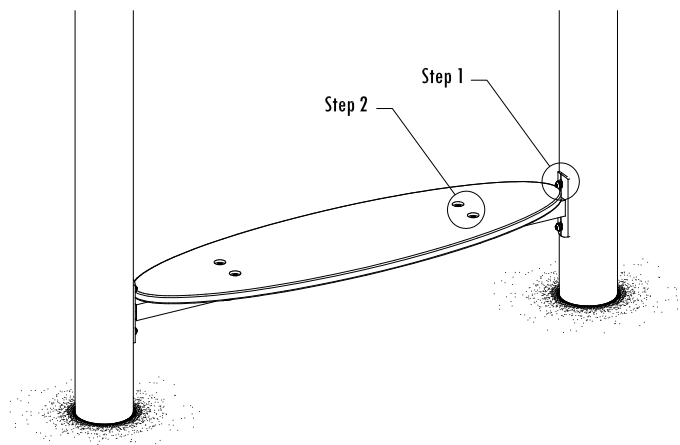


Parts List

- 8 2T-0604 - Button Cap Torx w/ Pin 3/8" x 1"
- 8 5F-0500 - Flat Washer 5/16" S/S w/ 3/8" Hole


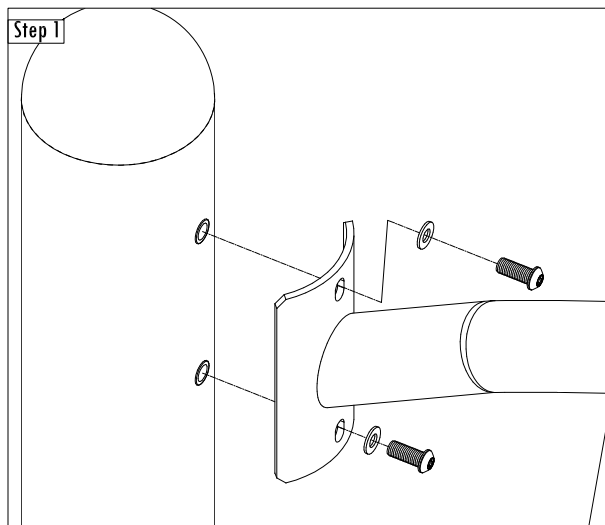


1" Button Cap, Flat Washer (x8)

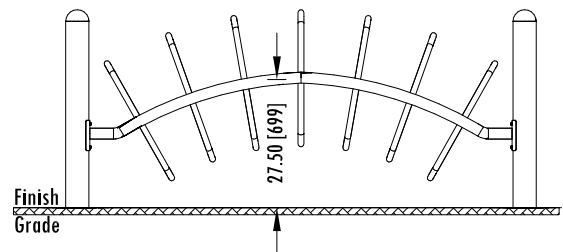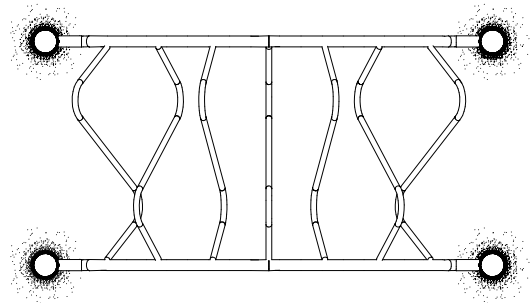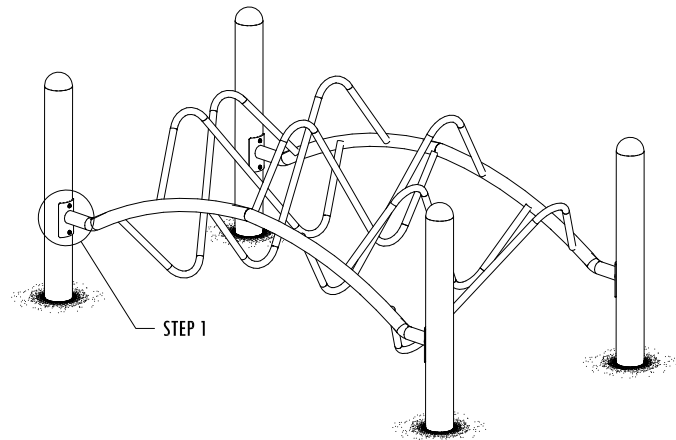


Parts List


6	CLA04000	Cable Pod Assembly
1	CLM20200	Cable Pod Upper Support
1	GND11500	Cable Pod Ground Leg
6	GND13000	Cable Pod (HD) Chain 12"
14	2T-0604	Button Cap Torx w/ Pin 3/8" x 1"
4	4L-0600	Lock Nut 3/8"
6	4R-0603	Barrel Nut 3/8" x 3/4"
12	5F-0500	Flat Washer 5/16" S/S w/ 3/8" Hole
6	6Q-0500	Quick Link 5/16"

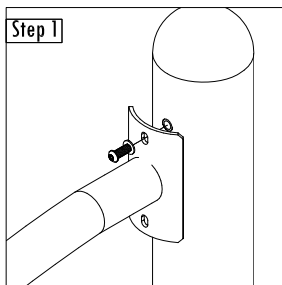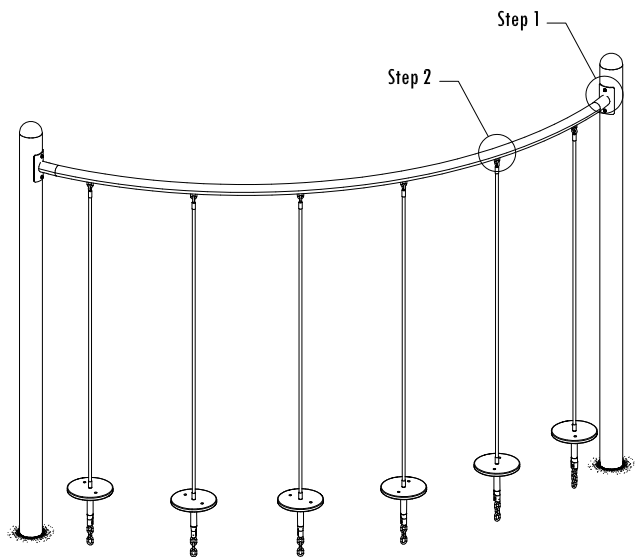


1" Button Cap Torx, Flat Washer (x4)

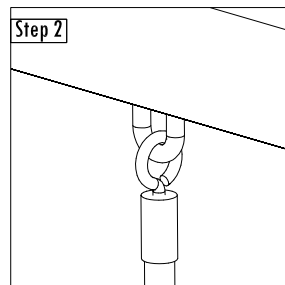



Crimp eyebolts closed, using pliers. (x12)

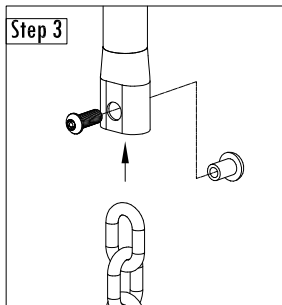


1" Button Cap, Barrel Nut (x6)

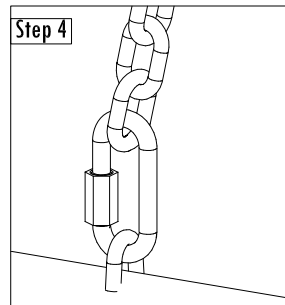

Quick Link (x6)

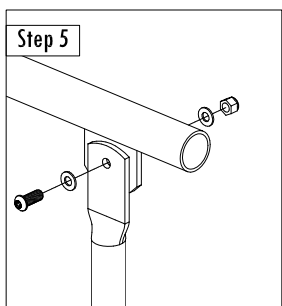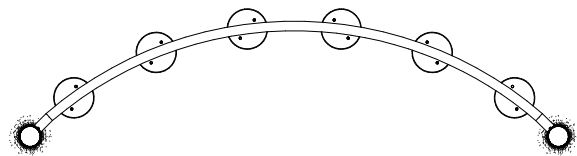


1" Button Cap Torx w/ Pin, Flat Washers, Lock Nut (x4)

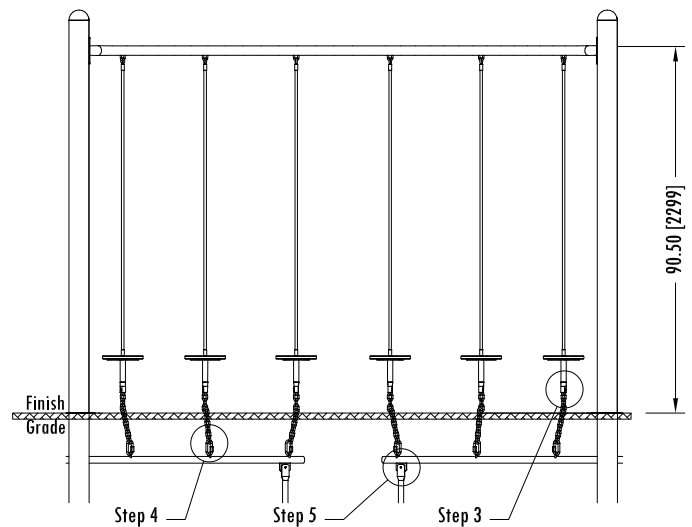


Parts List



2		Double Wave Climber Panel
12	BRK00400	Sheet Plastic Bracket
24	2T-0604	Button Cap Torx w/ Pin 3/8" x 1"
12	4R-0603	Barrel Nut 3/8" x 3/4"
24	5F-0600	Flat Washer 3/8"

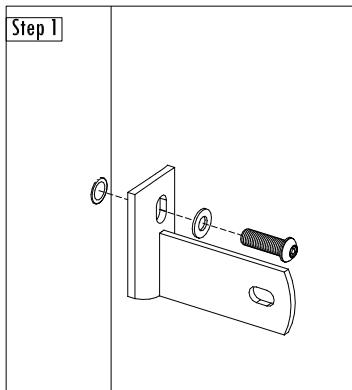

1" Button Cap Torx, Flat Washer (x12)

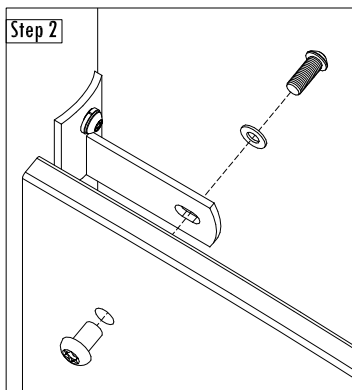

1" Button Cap Torx, Flat Washer, Barrel Nut (x12)

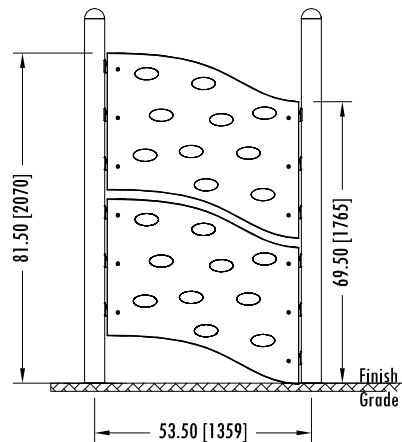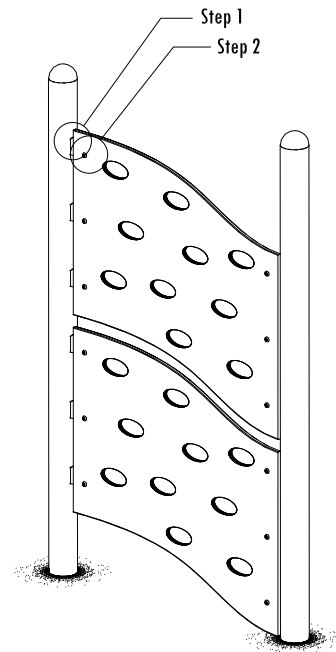




This Instruction Applies To The Following Modules :

LK004	Tidal Wave Link	LK008	Wavy Link
LK006	Camelback Link	LK015	Ribcage Link
LK007	Twisty Link		


Parts List

2	Link Connector		
4	Safety Railing		
1	Link		
16	2T-0604	Button Cap Torx w/ Pin 3/8" x 1"	
4	2T-0610	Button Cap Torx w/ Pin 3/8" x 2-1/2"	
4	4N-0600	Locking Flange Nut 3/8"	
20	5F-0500	Flat Washer 5/16" S/S w/ 3/8" Hole	


DECK HOLES USED

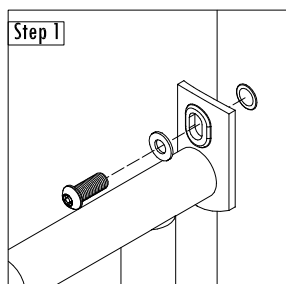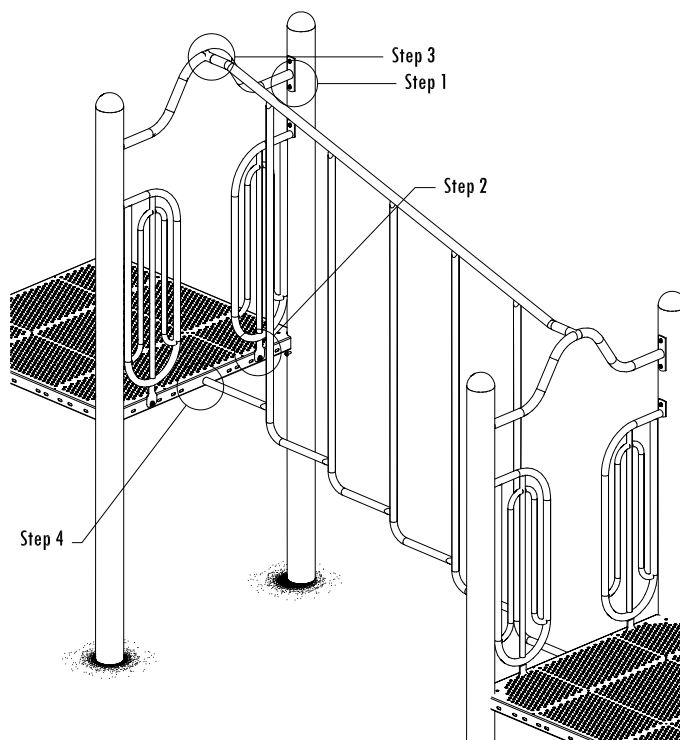


1" Button Cap Torx, Flat Washer (x12)

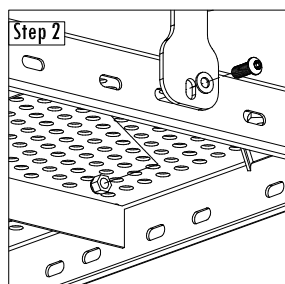


1" Button Cap Torx, Flat Washer, Locking Flange Nut (x4)

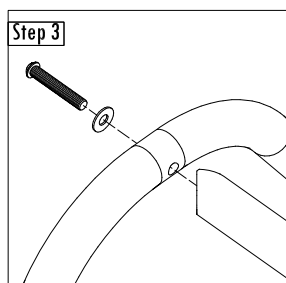

2-1/2" Button Cap Torx, Flat Washer (x2)

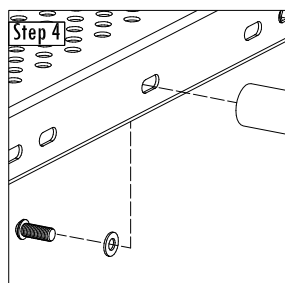

2-1/2" Button Cap Torx, Flat Washer (x2)

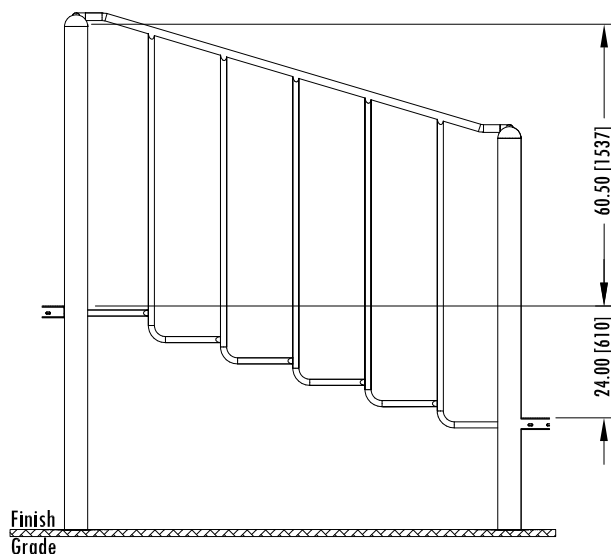

OFFICE USE ONLY

PLAYSTEEL SQ
N/A

PLAYSTEEL MAX
B5-LK004-02
B5-LK006-01
B5-LK007-01
B5-LK008-01
B5-LK015-01

PLAYSTEEL FIT
B3-LK004-02
B3-LK006-02
B3-LK007-02
B3-LK008-02
B3-LK015-02

B4-LK004-02

ORBIS
N/A

PLAYTOTS
N/A

PAGE 1 OF 1



08/25/2016

This Instruction Applies To The Following Modules :


BA012	Stepping Stone 6"
BA013	Stepping Stone 12"
BA014	Stepping Stone 18"
BA017	Stepping Stone 24"
BA018	Stepping Stone 30"

Parts List

1	CLA01100	Stepping Stone
1		Ground Leg
4	1M-0504	Machine Bolt 5/16" x 1"
4	5F-0500	Flat Washer 5/16" S/S w/ 3/8" Hole

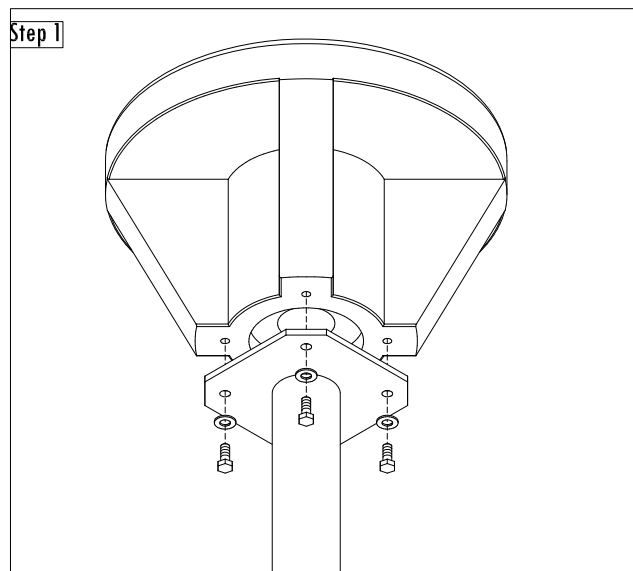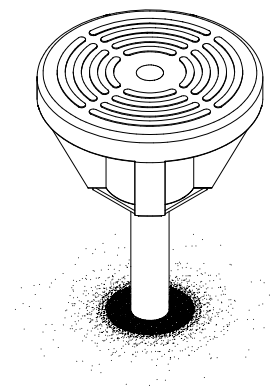


1" Machine Bolt, Flat Washer (x4)

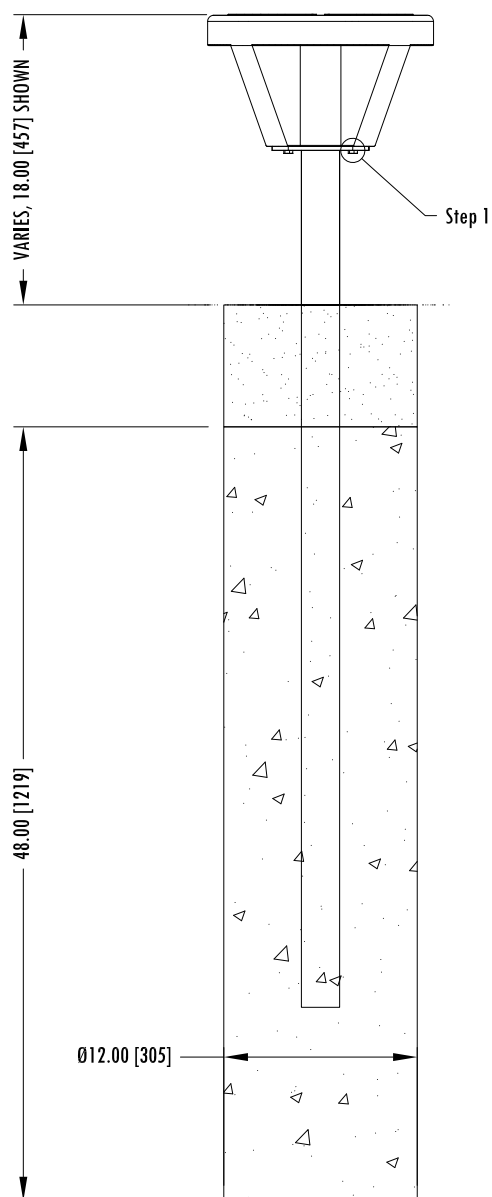

Parts List




3 CLA05300 Vertical Triangle Link & Cable Assembly
1 or 3 FRM07500 Vertical Triangle Link Frame

24 or 30 2T-0604 - Button Cap Torx w/ Pin 3/8" x 1"
24 or 30 5F-0500 - Flat Washer 5/16" S/S w/ 3/8" Hole

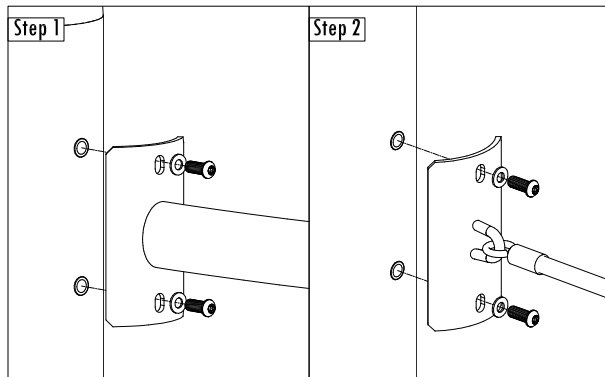


1" Button Cap, Flat Washer (x12)

1" Button Cap, Flat Washer (x18)
 Crimp eyebolts closed, using pliers (x9)

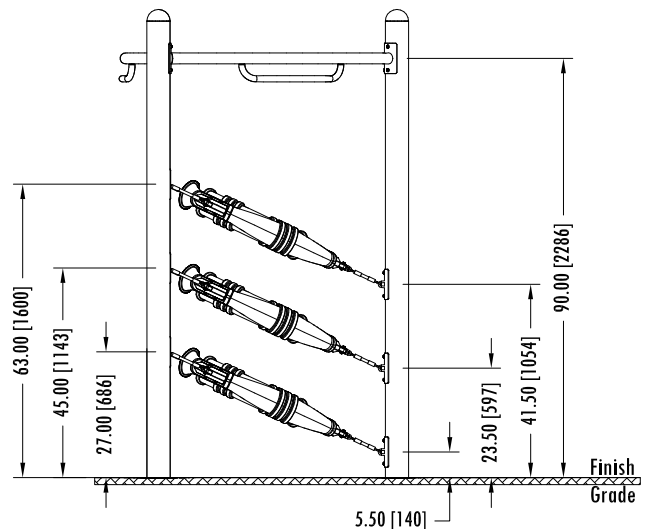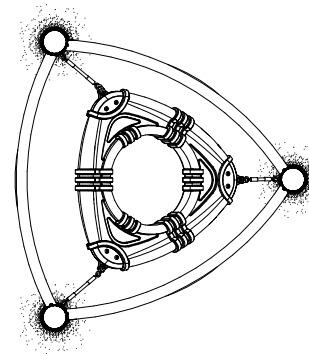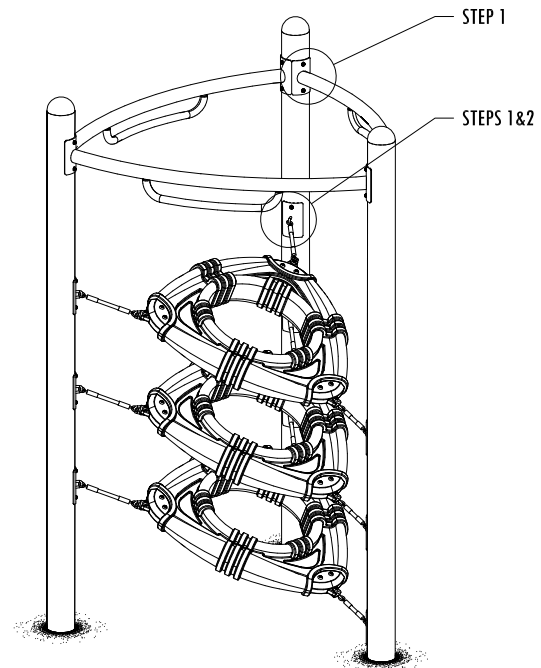


Parts List


1	CLA04600	Slack Line
2	FRM07000	Upper Rail
4	2T-0604	Button Cap Torx w/ Pin 3/8" x 1"
4	5F-0500	Flat Washer 5/16" S/S w/ 3/8" Hole
2	6C-0800	Large U Shackle

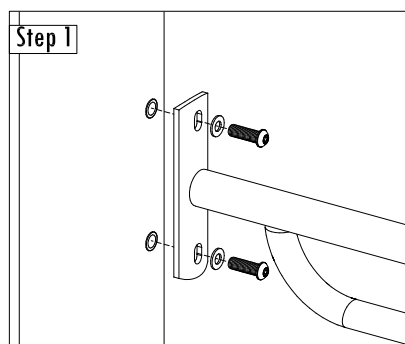

1" Button Cap Torx, Flat Washer (x4)

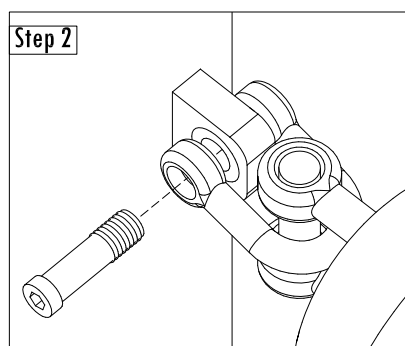

Large U Shackle (x2)

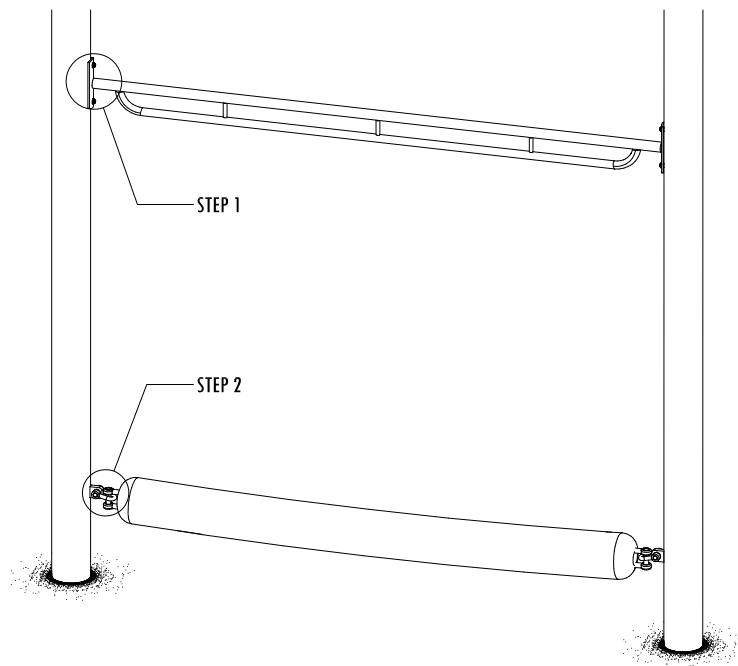


This Instruction Applies To The Following Modules :


OH006 Loop Challenge	OH046 Snaky Loop Challenge - Left
OH008 Loop To Loop	OH047 Snaky Trapeze Challenge - Right
OH012 Trapeze Challenge	OH048 Snaky Trapeze Challenge - Left
OH026 Zipper	OH055 90 Degree Trapeze Challenge
OH027 Rippled Zipper	OH060 Triangle Rung Overhead
OH031 90 Degree Loop Challenge	OH601 6' Loop-to-Loop
OH040 Single Snake Rail Challenge	OH603 6' Triangle Rung Overhead
OH045 Snaky Loop Challenge - Right	

Parts List




- 1 Overhead Activity
- 2 OHE04300 Overhead Support Bar
- 12 2T-0604 - Button Cap Torx w/ Pin 3/8" x 1"
- 12 5F-0500 - Flat Washer 5/16" S/S w/ 3/8" Hole

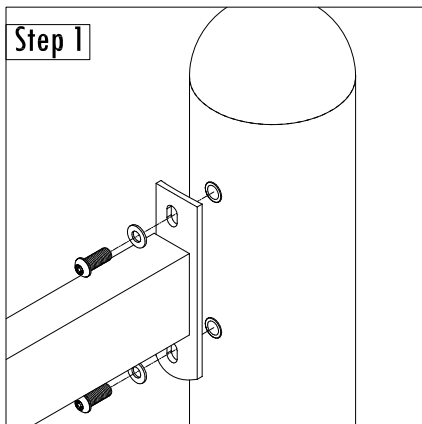

1" Button Cap, Flat Washer (x8)

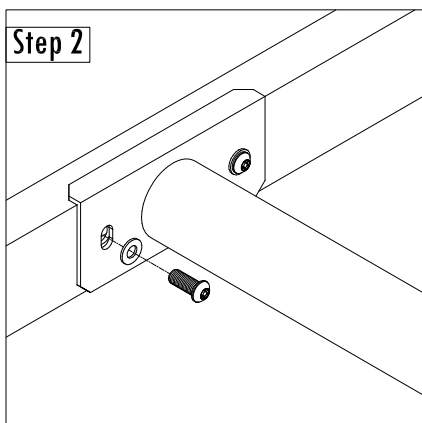

1" Button Cap, Flat Washer (x4)

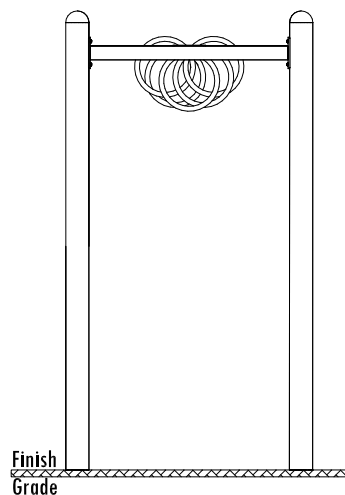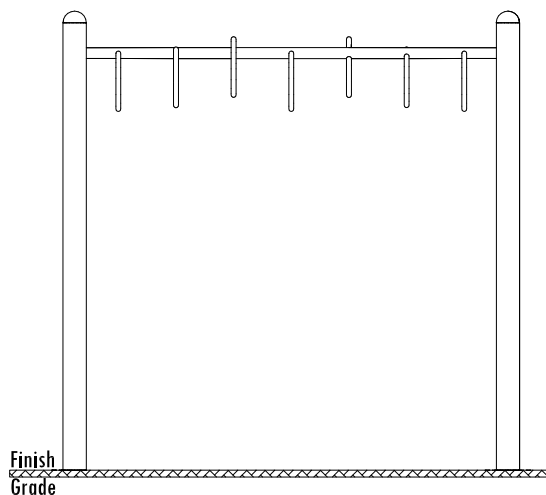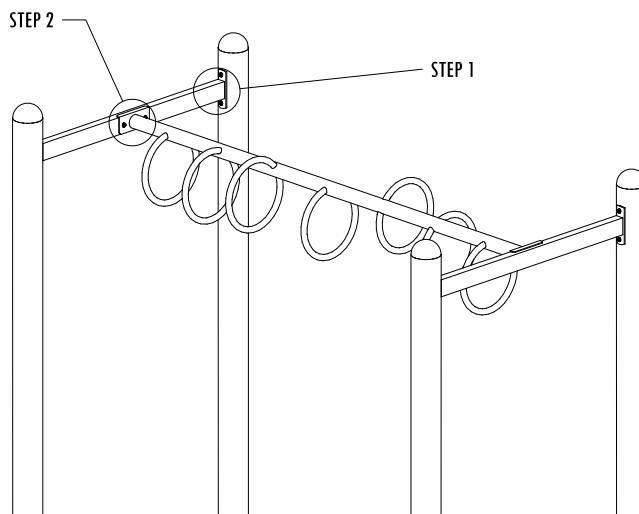

OFFICE USE ONLY



10/27/2016

PLAYSTEEL SQ N/A	PLAYSTEEL MAX B5-OH006-01 B5-OH046-00 B5-OH008-01 B5-OH047-00 B5-OH012-01 B5-OH048-00 B5-OH026-01 B5-OH055-00 B5-OH027-00 B5-OH060-00 B5-OH031-01 B5-OH601-00 B5-OH040-00 B5-OH603-00 B5-OH045-00	PLAYSTEEL FIT B3-OH006-00 B3-OH048-00 B3-OH008-00 B3-OH060-00 B3-OH012-00 B4-OH006-00 B4-OH047-00 B3-OH026-02 B4-OH008-00 B4-OH048-00 B3-OH031-01 B4-OH012-01 B4-OH060-00 B3-OH045-00 B4-OH031-01 B3-OH046-00 B4-OH045-00 B3-OH047-00 B4-OH046-00	ORBIS N/A	PLAYTOTS N/A	PAGE 1 OF 1
---------------------	---	---	--------------	-----------------	-------------


Parts List

- 1 DCK01200 Threshold
- 5 2T-0604 - Button Cap Torx w/ Pin 3/8" x 1"
- 3 4N-0600 - Locking Flange Nut 3/8"
- 5 5F-0500 - Flat Washer 5/16" S/S w/ 3/8" Hole

DECK HOLES USED

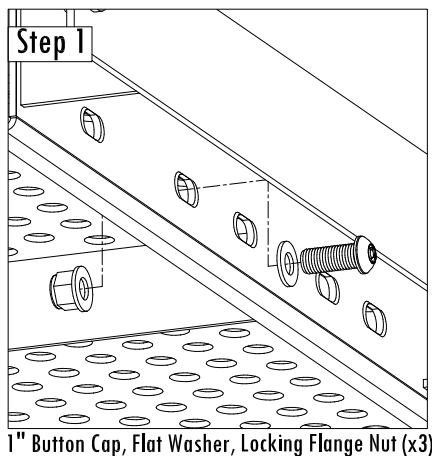

1" Button Cap, Flat Washer, Locking Flange Nut (x3)

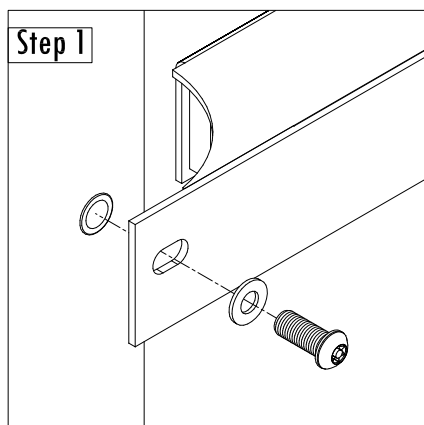

1" Button Cap, Flat Washer (x2)

